

# SIEMENS

## UROSOP Access

SP

### Service Instructions

SP007/04/R

Title: Hotfix MS04-011/012

Reason for Update:

☒ Reliability

Urgency: ☐ Immediate ☒ Within 12 months

Update material required? ☒ Yes ☐ No

Materials free of charge? ☒ Yes ☐ No

Return of parts? ☐ Yes ☒ No

Estimated completion time: 1 Number of CSE's:1

Customer application training? ☐ Yes ☒ No

☐ Required for all systems under warranty or covered by service contract.

☒ Required for all affected systems.

#### Systems/Products affected/System identifying IVK

Name	Material No.	Serial No.
UROSOP Access R	57 56 130	02001 - 02037 04001 - 04010
UROSOP Access L	57 56 122	01001 - 01087 03001 - 03009

#### Components affected/to be modified/IVK

Name	Material No.	Serial No.	Component status Affected
n.a.	n.a.	n.a.	n.a.

Remark:

Chg. Ref. No.: 8643517 ECM 01S 01

Name: Arnold

Dept.: CS PS 24

© Siemens AG 2004

The reproduction, transmission or use of this document or its contents is not permitted without express written authority. Offenders will be liable for damages. All rights, including rights created by patent grant or registration of a utility model or design, are reserved.

Print No.: SPL5-330.898.07.01.02

Doc. Gen. Date: 05.04

Replaces: n.a.

Version 2.1; January 14, 2003

Page 1 of 10

**Document Revision Level**

This document corresponds to the version/revision level effective at the time of system delivery. Revisions to hardcopy documentation are not automatically distributed.

Please contact your local Siemens office to order current revision levels.

**Disclaimer**

The installation and service of equipment described herein is to be performed by qualified personnel who are employed by Siemens or one of its affiliates or who are otherwise authorized by Siemens or one of its affiliates to provide such service.

Assemblers and other persons who are not employed by or otherwise directly affiliated with or authorized by Siemens or one of its affiliates are directed to contact one of the local offices of Siemens or one of its affiliates before attempting installation or service procedures.

## Systems/Products Affected

UROSKOP Access R, material number 57 56 130,  
serial numbers  $\leq$  02001 - 02037 and serial numbers 04001 - 04010.

UROSKOP Access L, material number 57 56 122,  
serial numbers  $\leq$  01001 - 01087 and 03001 - 03009.

### NOTE

**UROSKOP Access systems with higher serial numbers and Imaging software VA14A are updated with the hotfixes from the factory.**

**You must reinstall the hotfixes if system software was reloaded.**

**The software can be found on the CD media 86 43 517, delivered with the system.**

**The hotfixes can be installed, following the descriptions of this SI. Start with section "Hotfix installation".**

UROSKOP Access systems with higher serial numbers and Imaging software VA14A

## Reason for the Update

Protection against virus.

## Prerequisites

The imaging system software VA14A is installed. If this is not the case, perform update to VA14A before installing the UROSKOP Access hotfix (refer to UI SP001/04/P).

The patch needs to be downloaded from the intranet (refer to Work Steps).

## Service tools

Protective conductor meter e.g.	44 15 899
or Safety meter e.g. Bender safety meter	97 06 979
System binder	
Software Description	SPL5-330.815.02....
Software Description for VA14A	SPL5-330.815.03....

## Ordering Information

- The patch needs to be downloaded from the intranet (refer to Work Steps).
- The self-extracting zip file 'UROSCOP\_Access\_MS04\_011\_012.exe' includes the files 'windowsnt4workstation-kb835732-x86-enu.exe', 'windowsnt4workstation-KB828741-x86-enu.exe' and 'verify.bat'.
- Extract the self-extracting zip file 'UROSCOP\_Access\_MS04\_011\_012.exe' to a separate directory on your PC.
- Copy (burn) all files included in the directory on a CD-R media.

**Special Tools / Documents**

System binder UROSKOP Access

**Contents of the Update Kit**

n.a.:

**Return of Parts**

n.a..

## Work Steps

### Prerequisites

The Imaging system software VA14A is installed. If this is not the case, perform update to VA14A before installing the UROSKOP Access hotfix. See UI SP001/04/P.

### Preparation

- Download the self- extracting file 'UROSKOP\_Access\_MS04\_011\_012.exe'.  
The file can be found in the intranet at the following path:  
'For Service' - 'SP' - 'Litho/Uro/P'Therapy' - 'UROSKOP ACCESS' - 'Software' - 'UROSKOP\_Access\_MS04\_011\_012.exe'.
- Extract the self-extracting files on your PC.  
The files 'windowsnt4workstation-kb835732-x86-enu.exe',  
'windowsnt4workstation-kb828741-x86-enu.exe' and 'verify.bat' will be extracted into the new directory.
- Copy (burn) all files included in the new directory on a CD-R media.

### Hotfix installation

- Start the UROSKOP ACCESS System.
- When the system is running, make sure that no patient is currently registered.
- Take the media to the UROSKOP ACCESS ASPIA imaging system and insert it into the CD-R drive.

<b>NOTE</b>
-------------

<b>On machines with 2 CD ROM drives, use the same drive as used for the software installation.</b>
--

- Enter the local service.
- In service main menu, select <Utilities>.
- On utilities page, select <Escape to OS>.
- Check the CD-R drive and directory.
- Enter the command: <dir r:\> and press enter.  
The directory contains the hotfixes 'windowsnt4workstation-kb835732-x86-enu.exe' and 'windowsnt4workstation-kb828741-x86-enu.exe'.
- Enter the command <r:\windowsnt4workstation-kb835732-x86-enu.exe /z /q>.
- Select "Go".  
Wait until the output area of the service page (previously containing the directory listing from above) becomes blank.  
- The hotfix is done.
- Enter the command <r:\windowsnt4workstation-kb828741-x86-enu.exe /z /q>.
- Select "Go".  
Wait until the output area of the service page (previously containing the directory listing from above) becomes blank.  
- The hotfix is done.
- Click on <Home>.

- Close the local service browser window.
- Switch off the UROSKOP ACCESS, using the button on the control unit (do not simply interrupt power supply).
- The UROSKOP ACCESS shuts down.

**NOTE**

**Potential error dialogs are part of the update procedure and have to be acknowledged. During subsequent shutdowns no more error dialogs will appear.**

- Wait until the shutdown is completely done (the imaging system has switched off).

**Verifying the Hotfixes are installed**

- The CD-ROM media is still inserted in the CD-ROM drive.
- After installation of the hotfixes, switch on the UROSKOP Access and wait until startup is completely done.
- Enter local service.
- In service main menu, select <Utilities>.
- On utilities page, select <Escape to OS>.
- Check the CD-R drive and directory.
- Enter the command <r:\verify.bat and press enter.
- The "Add/Remove Programs" dialog appears. The dialog may be covered by the service window. So move the service window to see the "Add/Remove Programs" dialog.
- Scroll down the list and check for the entry "Windows NT 4.0 Workstation Hotfix - KB835732".
- Check for the entry "Windows NT 4.0 Workstation Hotfix - KB828741".
- If both entries are listed, the installation of the hotfixes was successful.
- Close the "Add/Remove Programs" dialog.
- Click on "Home"
- Close the service browser.

**Service information.****NOTE**

**You must reinstall the hotfixes if system software was reloaded.**

**Customer Information**

n.a.

## Final Work steps

- Mark the CD ROM as 'UROSOP\_Access\_MS04\_011\_012.exe' and the current date.
- Insert the marked CD-ROM in the system binder.
- If the system covers needed to be removed, reattach all covers and perform the protective conductor test in accordance with ARTD-002.731.17...
- Perform a function test on the UROSOP Access.
- Update the system documentation.  
Fill out, and if needed, make a copy of the attached "Completion Protocol/ Update Completion Form" and file it in the corresponding System Binder/User Handbook.
- Updates that have already been completed prior to publication of this SI must also be reported.
- The update is reported as follows:  
The modification reply report has to be prepared by authorized personnel using an application on the intranet.

This page intentionally left blank.



Material number: .....

Serial number: .....

Customer No.: .....

Country: ..... Location: .....

Remark: .....

**After completing the update, make a copy of this page, fill it out and file it in the corresponding System Binder/User Handbook.**

This page intentionally left blank.